
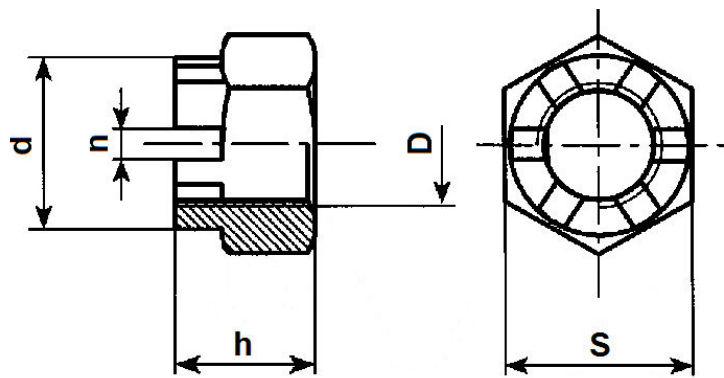


DADI ESAGONALI ALTI AD INTAGLI PASSO GROSSO

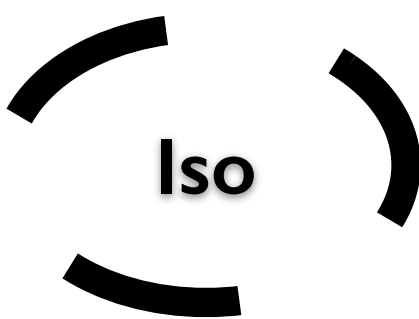

D	Passo	d	s	n	N° intagli	h 5593	h 935
M8	1,25	d = s	13	2,5	6	9,5	9,5
M10	1,5	d = s	17	2,8	6	12	12
M12	1,75	17	19	3,5	6	15	15
M14	2	19	22	3,5	6	16	16
M16	2	22	24	4,5	6	19	19
M18	2,5	25	27	4,5	6	21	21
M20	2,5	28	30	4,5	6	22	22
M22	2,5	30	32	5,5	6	26	26
M24	3	34	36	5,5	6	27	27
M27	3	38	41	5,5	6	30	30
M30	3,5	42	46	7	6	33	33
M33	3,5	46	50	7	6	35	35
M36	4	50	55	7	6	38	38
M39	4	55	60	7	6	40	40
M42	4,5	58	65	9	8	46	46
M45	4,5	62	70	9	8	48	48
M48	5	65	75	9	8	50	50
M52	5	70	80	9	8	54	54
M56	5,5	75	85	9	8	57	57
M60	5,5	80	90	11	8	63	63